


HAND CRIMP TOOL Specification Sheet Order No. 63811-8100

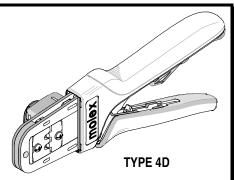

FEATURES


- A full cycle ratcheting hand tool ensures complete crimps
- Ergonomic soft grip handles for comfortable crimping
- A precision user-friendly terminal locator wire stop holds terminals in the proper crimping position
- Right and Left handed applications
- This tool is WHMA-IPCA620 Class 2 compliant as indicated
- This tool is RoHS compliant, however RoHS compliant is not required

SCOPE

Products: 2.50mm (.098") Pitch Mini-Lock™ Wire-to-Board Crimp Terminal, 22-28 AWG.

Terminal	Terminal (Wi	re Size	Insulation	Diameter	Strip Length		
Series No.	Loose Piece	*Reel	AWG	mm²	mm	In.	mm	In.
50351	50351-8100	50351-8000	22-28	0.33-0.08	1.10-1.70	.043067	2.30-2.80	.090110
* Follow the Cut-Off Tab specifications on Applicator specification sheets.								

DEFINITION OF TERMS

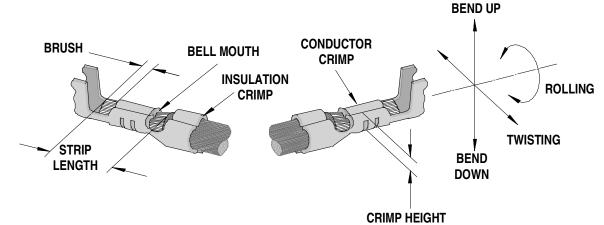

The above terminal drawing is a generic terminal representation. It is not an image of a terminal listed in the scope.

Release Date: 06-26-07 Revision Date: 06-26-07 **UNCONTROLLED COPY**


CONDITIONS:

After crimping, the conductor profiles should measure the following.

Terminal Series No	Wire Size		Conductor Crimp			Insulation Crimp			Pull Force		Profile			
			Height (Ref.)		Width (Ref.)		Height (Ref.)		Width (Ref.)		Minimum		TIONE	
Terminal Series No	AWG	2 2	mm	ln.	mm	ln.	mm	ln.	mm	ln.	Ν	Lb.	22-24	26-28
50351	22	0.33	0.71-0.81	.028032	1.26	.050	1.77	.070	1.62	.064	39.2	8.82	Х	
	24	0.20	0.71-0.81	.028032	1.26	.050	1.77	.070	1.62	.064	29.4	6.61	Х	
	26	0.12	0.63-0.73	.025029	1.26	.050	1.66	.065	1.59	.062	19.6	4.41		Х
	28	0.08	0.63-0.73	.025029	1.26	.050	1.66	.065	1.59	.062	9.8	2.20		Х

OPERATION

CAUTION: Install only Molex terminals listed above with this tool. Do not crimp hardened objects as damage can occur to the tool or die.

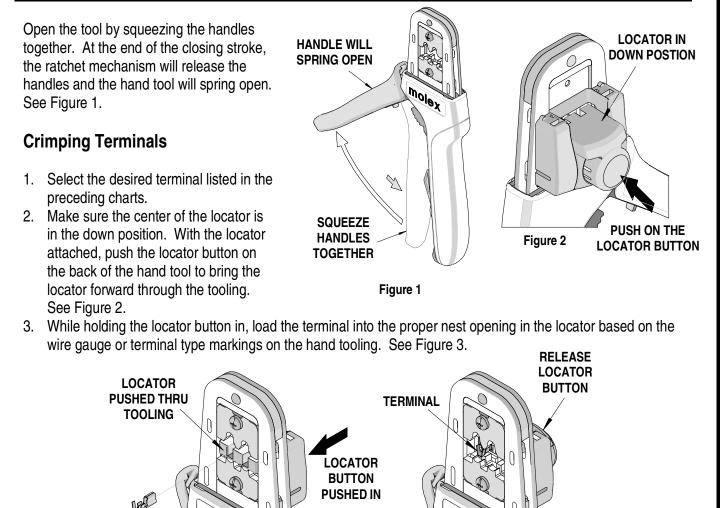


Doc No: ATS-638118100 Revision: A

Release Date: 06-26-07 Revision Date: 06-26-07

TERMINAL


: 06-26-07 UNCONTROLLED COPY

Figure 3

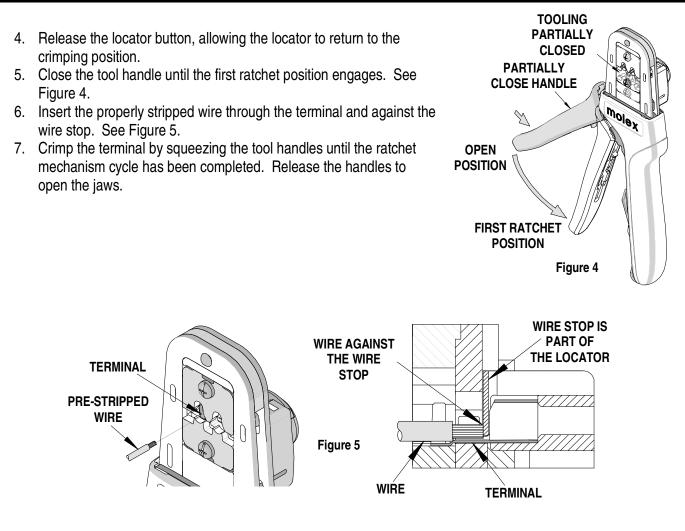

Note: The tamper proof ratchet action will not release the tool until it has been fully closed.

- 8. Remove the crimped terminal from the terminal locator by pulling on the wire.
- 9. Visually inspect the crimped terminal for proper crimp location.
- 10. On some large O.D. wires, it may not be possible to insert the wire with the tool partially closed. Those wires should be inserted with the hand tool in the open position. Insert the wire above the terminal in the punch and against the wire stop then close the tool. See Figure 6.

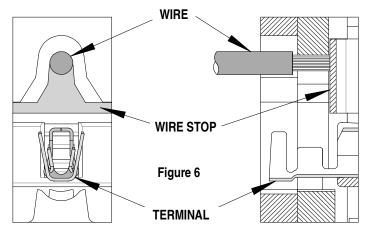

UNCONTROLLED COPY

Note:

A crimp height chart is provided with this manual as <u>Reference Only.</u> Due to the wide range of wires, strands, insulation diameters, and durometers available, actual crimp height measurements may very slightly. An occasional, destructive, pull force test should be preformed to check hand tool crimp. Pull Force value <u>Must</u> exceed the Minimum pull force specifications listed.


Locator Replacement

See the parts list on the last page of this document for the proper locator order number. Follow the steps below to replace the locator.

- 1. Open the crimp hand tool.
- 2. Squeeze gently on the lower area shown in Figure 7A with your thumb and index finger. The lower tabs of the locator should disengage from the hand tool.
- 3. Lift and pull away from the hand tool. The top locator hooks should slip out of the top slots easily. See Figure 7A.
- 4. To reinstall the new locator, make sure the hand tool is in the open position.
- 5. Press the red insert down as far as it will go as shown in Figure 7B.
- Holding onto the lower part of the locator with your thumb and index finger, insert the locators top hooks (2) into the hand tool top slots.
- 7. Rotate the locator down and press the lower tabs into the two bottom slots of the hand tool. To secure the locator into place, the lower tabs must snap into place on the hand tool the frame.

Right or Left Hand Operation

This hand tool has an added feature that can be converted from a right handed application to a left handed application. It is necessary to reverse the tooling if using the left handed application along with the locator. Follow the steps below:

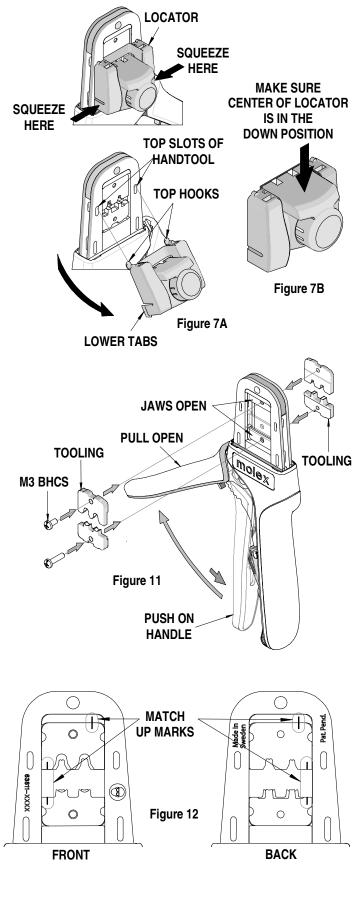

Release Date: 06-26-07 Revision Date: 06-26-07

- 1. The locator must be removing before reversing the tooling.
- 2. Remove the M3 BHCS which is holding the upper tooling.
- 3. Flip the upper tooling to the opposite side and replace the M3 BHCS Make sure the small markings on the front and back of the hand tool frame match up and are on the outside of the hand tool frame. See Figure 11 and 12.
- 4. Do the same thing with the lower tooling and tighten the M3 screws. Be sure the small markings line up.
- 5. Reinstall the locator by following the Instructions in the locator replacement section.

Maintenance

It is recommended that each operator of the tool be made aware of, and responsible for, the following maintenance steps:


- 1. Remove dust, moisture, and other contaminants with a clean brush, or soft, lint free cloth.
- 2. Do not use any abrasive materials that could damage the tool.
- 3. Make certain all pins; pivot points and bearing surfaces are protected with a thin coat of high quality machine oil. Do not oil excessively. The tool was engineered for durability but like any other equipment it needs cleaning and lubrication for a maximum service life of trouble free crimping. Light oil (such as 30 weight automotive oil) used at the oil points, every 5,000 crimps or 3 months, will significantly enhance the tool life.
- 4. Wipe excess oil from hand tool, particularly from crimping area. Oil transferred from the crimping area onto certain terminations may affect the electrical characteristics of an application.
- 5. When tool is not in use, keep the handles closed to prevent objects from becoming lodged in the crimping dies, and store the tool in a clean, dry area.

Miscrimps or Jams


Should this tool ever become stuck or jammed in a partially closed position, **Do Not** force the handles open or closed. The tool will open easily by pressing up on the ratchet release lever in the movable handle. See Figure 9.

How to Adjust Tool Preload (See Figure 10)


This hand tool is factory preset to 25-45 LBS. preload. It may be necessary over the life of the tool to adjust tool handle preload force. Listed below are the steps required to adjust the crimping force of the hand tool to obtain proper crimp conditions:

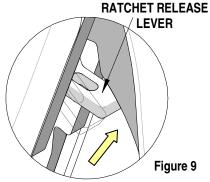

- 1. Hold the hand tool in the palm of your hand as shown in Figure 10. Using the index finger squeeze the link towards the top of the hand tool frame. This will release the preload adjustment wheel.
- 2. Rotate the setting wheel counter-clockwise (CCW) to increase handle force. The numbers will display higher. To decrease handle force rotate the setting wheel clockwise (CW).

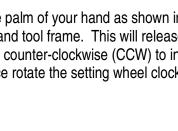


Release Date: 06-26-07 Revision Date: 06-26-07

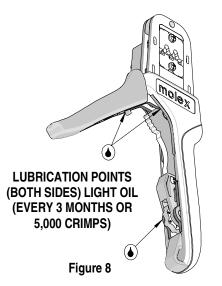

- 3. Release the link to lock the setting wheel in place.
- 4. Check the crimp specifications or conduct a pull test after tool handle preload force is adjusted.

Warranty

This tool is for electrical terminal crimping purposes only. This tool is made of the best quality materials. All vital components are long life tested. All tools are warranted to be free of manufacturing defects for a period of 30 days. Should such a defect occur, we will repair or exchange the tool free of charge. This

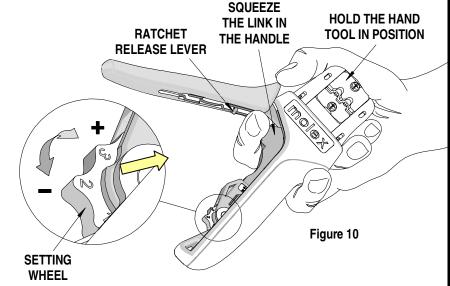

repair or exchange will not be applicable to altered, misused, or damaged tools. This tool is designed for hand use only. Any clamping, fixturing, or use of handle extensions voids this warranty.

CAUTION: Molex crimp specifications are valid only when used with Molex terminals and tooling.

CAUTIONS:

- 1. Manually powered hand tools are intended for low volume or field repair. This tool is NOT intended for production use. Repetitive use of this tool should be avoided.
- 2. Insulated rubber handles are not protection against electrical shock.
- 3. Wear eye protection at all times.
- 4. Use only the Molex terminals specified for crimping with this tool.


Certification

Molex does not certify or re-certify hand tools but rather supplies the following guidelines for customers to re-certify hand tools.

- % This tool is qualified to pull force only. To re-certify, crimp a terminal to a wire, which has been stripped 12.7mm (1/2") long, so there is no crimping of the insulation. Pull the terminal and wire at a rate no faster than 25mm (1.00") per minute. See the Molex web site for the Quality Crimp Handbook for more information on pull testing.
- % If the tool does not meet minimum pull force values, handle preload should be increased and the pull test rerun, (See How To Adjust Preload).
- % When the hand tool is no longer capable of achieving minimum pull force, it should be taken out of service and replaced.

PARTS LIST

Item Number	Order Number	Description	Quantity		
REF	63811-8100	Hand Crimp Tool	Figure 13		
1	63811-8175	Locator Assembly	1		
2	63810-0104	Spring, Return	1		
3	63810-0105	Spring, Ratchet	1		

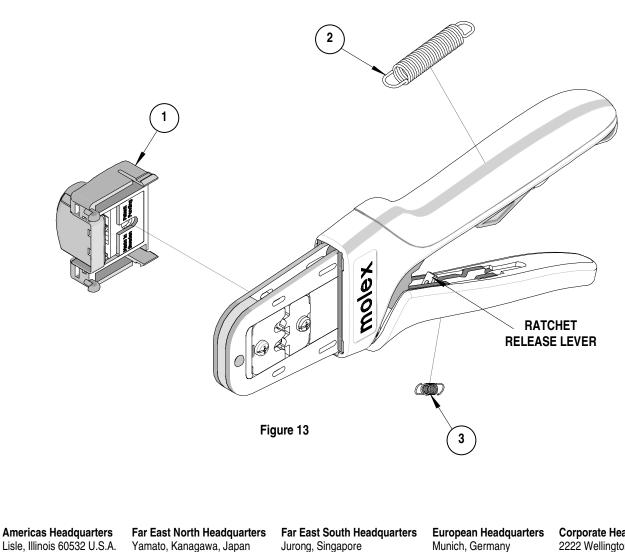

Lisle, Illinois 60532 U.S.A. 1-800-78MOLEX amerinfo@molex.com

81-462-65-2324 feninfo@molex.com 65-6-268-6868 fesinfo@molex.com

49-89-413092-0 eurinfo@molex.com **Corporate Headquarters** 2222 Wellington Ct.

Lisle, IL 60532 U.S.A. 630-969-4550 Fax: 630-969-1352

Visit our Web site at http://www.molex.com

Doc No: ATS-638118100 Revision: A

Release Date: 06-26-07 Revision Date: 06-26-07 **UNCONTROLLED COPY**