
## Flow sensor Immersion sensor with integrated processor FCS-G1/2A4P-LIX-H1141




Industri<mark>al Automation</mark>

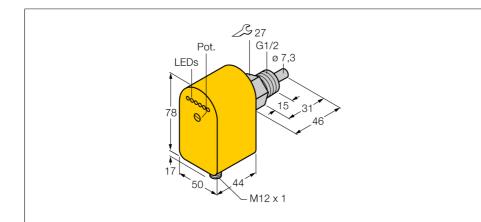

Type code	FCS-G1/2A4P-LIX-H1141
Ident no.	6870056
Operating range water	5150cm/s
Oil operating range	3300 cm/s
Stand-by time	approx. 10 s
Setting time	115 s
Medium temperature	-2080 °C
Ambient temperature	-20 70 °C
Operating voltage	2126VDC
No-load current I	≤ 100 mA
Output function	Analog output
Short-circuit protection	yes
Reverse polarity protection	yes
Current output	420mA
Linearity deviation	≤ 10 % of full scale
Load	$\leq$ 500 $\Omega$
Protection class	IP67
Housing material	Plastic, PBT
Sensor material	stainless steel, AISI 316Ti
Max. tightening torque housing nut	100 Nm
Connection	male, M12 x 1
Pressure resistance	100 bar
Mechanical connection	G ½"
Flow state display	LED chain, red (1x), green (5x)
LED display	red = 4 mA
	1x green > 4 mA
	2x green > 8 mA
	3x green > 12 mA


- Sensor for water
- Calorimetric principle
- Adjustment via potentiometer
- LED band
- With linearized analog output
- 3-wire DC, 21...26 VDC
- 4...20 mA analog output
- Plug-in device, M12 x 1

## Wiring diagram



## **Functional principle**

Our insertion - flow sensors operate on the principle of thermodynamics. The measuring probe is heated by several °C as against the flow medium. When fluid moves along the probe, the heat generated in the probe is dissipated. The resulting temperature is measured and compared to the medium temperature. The flow status of every medium can be derived from the evaluated temperature difference. Thus TURCK's wear-free flow sensors reliably monitor the flow of gaseous and liquid media.

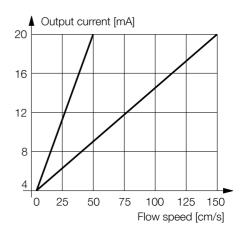

4x green > 16 mA

5x green = 20 mA