OMRON

Flat Cable Connectors for PCBs XG2


Ideal for high-density mounting. IDC design allows for quick termination.

- Part of a total flat cable wiring solution, when used in conjunction with XG4, XG5 and XG8 sockets and plugs.
- End terminates cable to a PCB or acts as a pass through for connection to other cables or PCB's.
- Uses a standard 2.54-mm grid terminal arrangement for easier design of circuits.
- Terminal Arrangement: standard or reverse.
- Uses UL94V-0 approved insulation material.
- IDC Assembly Tools are available.

XG2 Connectors

Terminal Arrangement

The contact numbers are not marked on the Connector. If the cables are numbered from 1 starting from the edge, the relationship between the wires and the terminals would be as shown below.

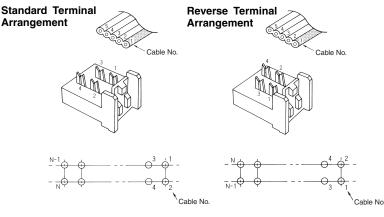

Cable number arrangement (top view)

Ratings and Characteristics

Rated current	1 A
Rated voltage	250 VAC
Contact resistance	15 m Ω max. (at 20 mV, 100 mA max.)
Insulation resistance	1,000 MΩ min. (at 500 VDC)
Dielectric strength	500 VAC for 1 min. (leakage current: 1 mA max.)
Operating temperature	-55°C to 85°C (with no icing at low temperature)

Materials and Finish

Base		Fiber-glass reinforced PBT resin (UL94V-0)/black
Contacts	Mating end	Copper alloy/nickel base, tin plating
	Terminals	Copper alloy/nickel base, tin plating
Cover		Fiber-glass reinforced PBT resin (UL94V-0)/black

The Carl and a second

■ Applicable Wires

1.27-mm pitch, AWG28, 7-strand flat cable.


- UL2651 (standard cable)
- UL20012 (folding cable)
- UL20028 (color-coded cable)

■ XG2A Dimensions

Standard Terminal Arrangement: XG2A-001 Reverse Terminal Arrangement: XG2A-002





No. of	Dimensions (mm)											
contacts	Α	В										
10	17.9	10.16										
14	22.9	15.24										
16	25.5	17.78										
20	30.6	22.86										
26	38.2	30.46										
30	43.3	35.56										
34	48.3	40.64										
40	56.0	48.26										
50	68.7	60.96										
60	81.4	73.66										
64	86.4	78.74										

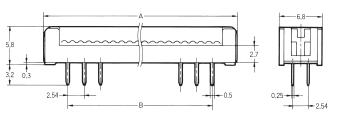

Mounting holes (bottom view)

Standard terminal arrangement

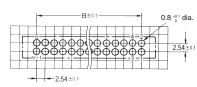

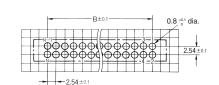

Reverse terminal arrangement

Note: The cover is an open-end type.

Ordering Information

Appearance											
No. of contacts	Connectors with standard terminal arrangement	Connectors with reverse terminal arrangement									
10	XG2A-1001	XG2A-1002									
14	XG2A-1401	XG2A-1402									
16	XG2A-1601	XG2A-1602									
20	XG2A-2001	XG2A-2002									
26	XG2A-2601	XG2A-2602									
30	XG2A-3001	XG2A-3002									
34	XG2A-3401	XG2A-3402									
40	XG2A-4001	XG2A-4002									
50	XG2A-5001	XG2A-5002									
60	XG2A-6001	XG2A-6002									
64	XG2A-6401	XG2A-6402									

Precautions

Correct Use

Handling

- There is no Strain Relief for the PCB Connector. Leave enough slack to avoid tension on the cable.
- Terminals can be press fit no matter which direction the base and cover are facing.
- See "XG
 – Assembly Tooling and Accessories" datasheet for information on flat cable / connector assembly tools.

Automated Soldering Conditions (Jet Flow)

- 1. Soldering temperature: 250 \pm 5°C
- 2. Continuous soldering time: Within 5 s

OMRON

																															M	
		_	—	T ·		-1		— —														т — _			— – I			T			_	
L.		—	 	上 . I		-!				—	 			_		L I	 _				⊥ - 1	 _	.!		 _						—	
 	_	_		 			_	<u> </u>	_	—	 	 		_		 	 	_			 	 _		 	 		-	 		'		
 			 	 +	 _+	-1	 	 		_	 	 +	 	_	 	 	 	-	י 		 +	 _+	 -	 	 	 _	 		 _+	 		
1	1		1	1			1	I I			 	1			 	1	1	1			1	1	1	1		1	1	I				
 		_	 	+- ·	-+ 1	-!			_		 	+	+	_		⊢ · I			— I	<u> </u>		+	-1		+ - 1			+	+			
	_	—		<u> </u>	<u> </u>		<u> </u>	<u> </u>	_	—		<u> </u>	<u> </u>	_		<u> </u>	<u> </u>	_			<u> </u>	<u> </u>		<u> </u>	<u> </u>		-	<u> </u>	<u> </u>	'	—	
 	-1		 	 	- -+	-1		+	_		 	 	-+	_	 —	⊢ ·	 	_	_		। ┿── -	⊥ + —	-1	 	 	- 	 	+	-+			
1	1		 	1	1	1	1	I I			I I	1			1	1	I I	1			1	1	1	1	I I	_	1	I I		1		
 						-1					— 	1	-			г— ·						+ -	-1				1	1	-			
		—	'	<u> </u>	<u> </u>	-'		<u> </u>		—	 	<u> </u>		—	' <u> </u>	L	 		_ '		<u> </u>	<u> </u>	-'			_!	-	<u> </u>		'	—	
г -		_	 	 						_	 	T	_		¦		 		_'		' T -	, т —			 	, 	-	т Т	_	'	_	
 			 	∣ ⊥ .	 	-1		+			 	 			 	∣ ∟ .	 	_	- I		 	 _+	 -		 	-		1	-			ı ı — -
1	1		 	1	1	1	1	I I														1		1	I I	1	1	I I	1	1		
L -		_	! 	 		-!					 	1		_	 	L .	 		'		 	 	-!		 		1	 		!		
	_	—	'	<u> </u>	<u> </u>		-	<u> </u>	_	—		<u> </u>	<u>_</u>	_	' —		<u> </u>	_	-'		<u> </u>	<u> </u>		-	<u> </u>		-	<u> </u>	<u> </u>	'	—	
⊢ -	_	_	 	+− .	- -+	-1	⊢	+	_		 	+		_	 —	⊢ .		_	— i		। +— -	' + —	-1				 	+				
1	1		 	1		1	1	I I	1		I I	1			 	1	1	1			1		1	1	1	1	1	I I	1	1		
	-	_		+- ·		-1				_		+		_		 					+ 	+	-1						-+		_	
 I	- <u>'</u>	—	'	<u>-</u> . 	<u> </u>	-' '	<u> </u>	<u> </u>		—	' 	<u> </u>	<u>_</u>	_	' <u>—</u>	' I	<u> </u>	-	- '		<u>-</u> - 	<u> </u>	·'	'	<u> </u>	_'	-	<u> </u>	<u> </u>	'	—	''
	-			+ .		-		+	-	—		†	+	_	—			-	-	—		+ -			- 		<u> </u>	+	+	-'		
	_				, , _	-		+	_			+	_					_	_			+ _	-		, + -	_		+	_			· ·
Ì	İ			Ì	Ì		Ì	Ì				1				Ì					Ì		Ì	Ì	1	1	Ì	Ì		İ		
-		_	' 	· ·		-' <u></u>	i	<u> </u>		_	' <u> </u>	<u> </u>	<u> </u>	_	' <u> </u>	· <u> </u>	- <u> </u>		- ' 	·	 	 	·'			_' 	i	<u> </u>	<u> </u>	'	_	
- -		—			<u> </u>	-i —	_	Ť		—		T	Ť	_			.	-	- ¦	—		- 	-i —		- -		<u> </u>	Ť	Ť	-'	—	
· 	-		—	+ ·	+ -	-	-	+	_	_	—	+	+	_	—		+ .	_	— i	—	+	+ —	-		+ -		· —	+	+			
Ŀ.		_		Ŀ.			L	Ĺ	_	_		Ĺ		_		Ľ.	Ŀ.		_		Ŀ.			Ĺ	Ŀ_	_		Ĺ				
							Ì	Ì									Ì											Ì				
		_			-				_	—				_			.		_		-		- <u> </u>		-	-				_	—	
⊢ -				+ .	+ -	-	\vdash	+	\neg	—		+	\rightarrow	_			+ -		-		+ -	+ -	-	\vdash	+ -			+	+	—	—	$\vdash \dashv$
⊢ -				Ļ.		-		_	_			\vdash	\downarrow	_		L .			_		Ļ -	+ _	-	\vdash	<u> </u>			_	\rightarrow			
Γ				\top	\top		\square	\top				Γ	\top	_	—		Τ.		_		Τ -	Τ –		\square	Τ -			\top	\neg	_		
⊢ -	-	_	—	+	+ -	-	\vdash	+	_	_	—	\vdash	+	_	—	⊢ ·	+ -	-	—	—	+ -	+ -	-	\vdash	+ -		-	\vdash	+	—		\vdash \dashv
L.				L.				\bot					\square			L.			_		L.	⊥ _			⊥ _			\square		_		
Γ		_		Γ						_		Γ		_							Γ										_	
├ -	-	_		+ -	+ -	-	\vdash	+	\neg	—		+	+	—	—	\vdash	+ -	-	-	—	+ -	+ -	-	\vdash	+ -			+	+	-	—	\vdash \dashv
L.				⊥ .	4 _	_		\perp		—		\perp	\downarrow	_			⊥.		_		⊥ -	↓ _			⊥ -			\perp	\downarrow	_		
				<u> </u>									_	_		L .	<u> </u>		_		<u> </u>				<u> </u>					_		
				+	+ -	-	\vdash	Ť				T	\dashv							—		† –			+ -			\vdash	\dashv	-		$\vdash \dashv$
	_	_		+ ·	+ -	-	<u> </u>	+		—		+	\rightarrow										-	<u> </u>	+ -	-		+	+	_		
L.				<u> </u>	<u> </u>	-!		<u> </u>			I	<u> </u>							_		<u> </u>	<u> </u>	-!		<u> </u>		<u> </u>			_		
											 			_																_		
							1									1		1			1						1					
L -		—	·	<u> </u>		-'	L			—	·	<u> </u>		_	· —	<u> </u>	<u> </u>				<u> </u>		- '				I	1				

All sales are subject to Omron Electronic Components LLC standard terms and conditions of sale, which can be found at http://www.components.omron.com/components/web/webfiles.nsf/sales_terms.html

ALL DIMENSIONS SHOWN ARE IN MILLIMETERS. To convert millimeters into inches, multiply by 0.03937. To convert grams into ounces, multiply by 0.03527.



55 E. Commerce Drive, Suite B Schaumburg, IL 60173

OMRON ON-LINE

Global - http://www.omron.com USA - http://www.components.omron.com

847-882-2288

Cat. No. X304-E-1

11/10

Specifications subject to change without notice

Printed in USA